



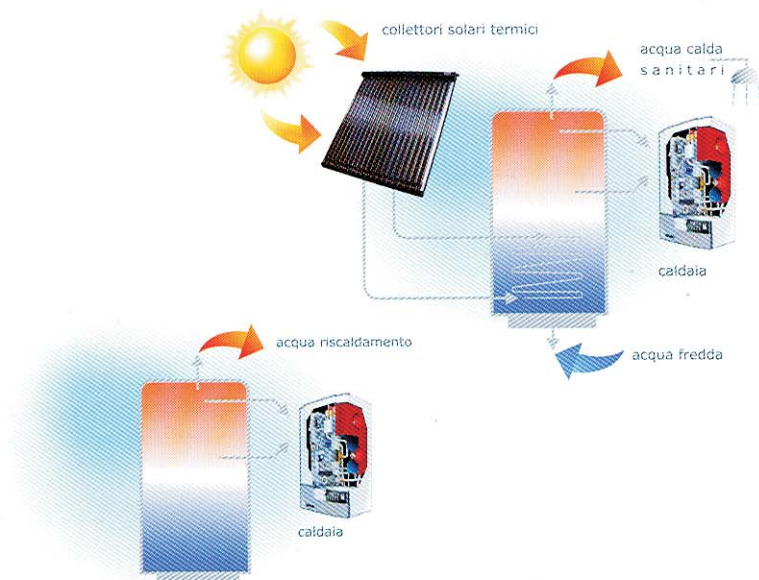

## accumulatori PS-PSR

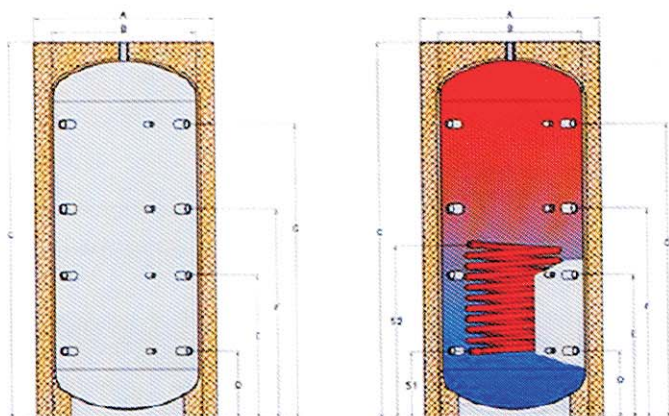

| modello      | A    | B    | C    | D         | E         | F         | G         | H    | I    |
|--------------|------|------|------|-----------|-----------|-----------|-----------|------|------|
|              |      |      |      | 1/2"-6/4" | 1/2"-6/4" | 1/2"-6/4" | 1/2"-6/4" | 5/4" | 5/4" |
| PS - PSR300  | 650  | 500  | 1660 | 205       | 610       | 1010      | 1415      | 205  | 755  |
| PS - PSR500  | 850  | 650  | 1650 | 230       | 615       | 995       | 1380      | 230  | 880  |
| PS - PSR800  | 1000 | 800  | 1380 | 305       | 690       | 1070      | 1455      | 305  | 890  |
| PS - PSR1000 | 1000 | 800  | 2080 | 305       | 775       | 1240      | 1705      | 305  | 935  |
| PS - PSR1250 | 1150 | 950  | 2050 | 300       | 770       | 1235      | 1700      | 300  | 990  |
| PS - PSR1500 | 1200 | 1000 | 2120 | 335       | 805       | 1270      | 1735      | 335  | 1010 |
| PS - PSR2000 | 1300 | 1100 | 2350 | 350       | 885       | 1420      | 1950      | 350  | 1150 |
| PS - PSR3000 | 1450 | 1250 | 2750 | 415       | 1050      | 1685      | 2135      | 415  | 1165 |
| PS - PSR4000 | 1600 | 1400 | 2850 | 460       | 1095      | 1730      | 2360      | 460  | 1210 |
| PS - PSR5000 | 1800 | 1600 | 2900 | 490       | 1125      | 1760      | 2390      | 490  | 1240 |

| modello | Superficie            | Portata | Temperatura |     | Potenzialità | Perdite   | Peso |     |
|---------|-----------------------|---------|-------------|-----|--------------|-----------|------|-----|
|         | Serpentino di scambio |         | DIN 4708    |     | DIN 4708     | di carico | PS   | PSR |
|         | mq                    | mc/h    | l/h         | Kw  | NL           | Mbar      | Kg   | Kg  |
| PSR300  | 1,5                   | 2,5     | 880         | 36  | 8,5          | 115       | 63   | 85  |
| PSR500  | 2,3                   | 3       | 1580        | 65  | 21           | 200       | 86   | 120 |
| PSR800  | 2,8                   | 4       | 1866        | 76  | 26           | 210       | 130  | 175 |
| PSR1000 | 3                     | 5       | 2032        | 88  | 31           | 230       | 145  | 190 |
| PSR1250 | 3,5                   | 5       | 2450        | 92  | 35           | 280       | 200  | 250 |
| PSR1500 | 4                     | 5,3     | 2790        | 108 | 40           | 380       | 220  | 270 |
| PSR2000 | 4,5                   | 5,7     | 2890        | 113 | 42           | 430       | 250  | 325 |
| PSR3000 | 4,5                   | 6,4     | 2890        | 113 | 42           | 430       | 360  | 440 |
| PSR4000 | 5                     | 6,8     | 3230        | 135 | 58           | 580       | 420  | 490 |
| PSR5000 | 6                     | 7,2     | 3450        | 140 | 62           | 670       | 560  | 600 |